DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES Office of Structural Materials

Quality Assurance and Source Inspection

Bay Area Branch 690 Walnut Ave.St. 150 Vallejo, CA 94592-1133 (707) 649-5453

(707) 649-5493

Contract #: 04-0120F4

Cty: SF/ALA Rte: 80 PM: 13.2/13.9

File #: 13.28

WELDING INSPECTION REPORT

Resident Engineer: Pursell, Gary **Report No:** WIR-005740 Address: 333 Burma Road **Date Inspected:** 12-Mar-2009

City: Oakland, CA 94607

OSM Arrival Time: 630 **Project Name:** SAS Superstructure **OSM Departure Time:** 1600 **Prime Contractor:** American Bridge/Fluor Enterprises, a JV

Contractor: Oregon Iron Works Clackamas, Or. **Location:** Clackamas, Oregon

CWI Name: See below **CWI Present:** Yes No **Inspected CWI report:** Yes N/A **Rod Oven in Use:** Yes No No N/A N/A **Electrode to specification:** Yes No Weld Procedures Followed: Yes No N/A N/A **Qualified Welders:** Yes No **Verified Joint Fit-up:** Yes No N/A N/A Yes N/A **Approved Drawings:** Yes No **Approved WPS:** No Yes No N/A **Delayed / Cancelled:**

34-0006 **Bridge No: Component:** Hinge K Pipe Beams

Summary of Items Observed:

On this date, Caltrans Quality Assurance Inspector (QA) Sherri Brannon is present at the Oregon Iron Works, Inc. (OIW) jobsite in Clackamas, Oregon for the purpose of observing fabrication of the Hinge K Pipe Beams.

OIW Fabrication Shop-Bay 1:

QA Inspector Brannon randomly observed OIW personnel and 1 helper continuing in Bay 1at the CNC mill for facing hinge k pipe beam post tension cap plate (A825M) MK#a109 in preparation for welding.

OIW Fabrication Shop-Bay 3:

QA Inspector Brannon randomly observed OIW qualified welder Mr. Tim O'Brien ID#O6 and I helper joining ring stiffener plate MK#a125 (HPS 485 W) to hinge K pipe beam fuse half section MK#a124-6 (HPS 485W). The partial joint penetration (PJP) weld is identified as weld joint #WM3-06. Mr. O'Brien was observed welding in the 1G (flat) position utilizing submerged arc welding (SAW) process with a 2.4mm diameter electrode, filler metal brand Lincoln Electric LA85 class F9A4-Eni5-G-H2. QA Inspector Brannon observed the OIW QC CWI Inspector's Mr. Mike Gregson, Mr. Jose Salazar and Mr. Rob Walters verifying that the pre-heat and welding parameters were in accordance with the Welding Procedure Specification (WPS). Welding parameters observed by QA Inspector Brannon appear to be in general compliance with the approved WPS 4020 revision number 0.

OIW Fabrication Shop-Bay 3:

QA Inspector Brannon randomly observed OIW personnel preparing positioner for welding forging MK#a111 (A508 Gr. 4N Class 2) to base plate ML#a110 in preparation for welding.


WELDING INSPECTION REPORT

(Continued Page 2 of 2)

Material, Equipment, and Labor Tracking:

QA Inspector Brannon performed a verification of personnel at OIW. QA Inspector Brannon observed 2 Supervisor's, 3 Quality Control and 5 production personnel on this date.

The following digital photograph below illustrates observation of the activities being performed.

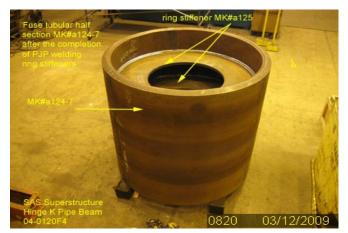



Summary of Conversations:

No relevant conversations on this date.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Mohammad Fatemi (916) 813-3677, who represents the Office of Structural Materials for your project.

Inspected By:	Brannon,Sherri	Quality Assurance Inspector
Reviewed By:	Adame,Joe	QA Reviewer